



Precision N Jack (Female) Connector Cable Entry: Solder Contact Pin: Plug-in Attachment Bulkhead
Mount For .141" Cables, DC-18GHz VSWR1.2

PCN2EA50-0141A / 8X

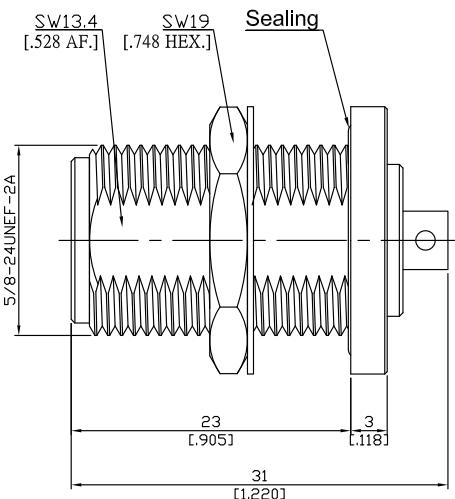

MOUNTING DIMENSIONS

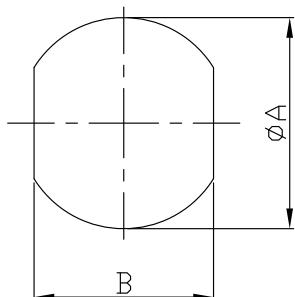

	mm	inch		
	MAX.	MIN.	MAX.	MIN.
A	16.1	16	.634	.630
B	13.7	13.6	.539	.535

All dimensions are in mm [inch]

Tolerances according to DIN ISO 2768-mH

Interface

According to

IEC 61169-16, MIL-STD-348B/304

Electrical Data

Impedance

50 Ω

Frequency

DC to 18 GHz

VSWR (Return Loss)

≤ 1.2 (≥ 20.08 dB)

Insertion Loss

≤ 0.05 x √F (GHz) dB

Insulation Resistance

≥ 5 x 10³ MΩ

Center Contact Resistance

≤ 1 mΩ

Outer Contact Resistance

≤ 1 mΩ

Working voltage

1000 V rms

RF-leakage

≥ 90 dB up to 1 GHz

- Limitations are possible due to the used cable type -

Material And Plating

Connector parts	Material	Plating
Centre contact	Beryllium Copper	Silver
Body	Stainless Steel	Passivated
Insulator	PTFE	
Gasket	Silicone Rubber	
Fastening nut	Stainless Steel	Passivated
Washer	Stainless Steel	Passivated

PCN Jack (Female) Connector Cable Entry: Solder
Contact Pin: Plug-in Attachment Bulkhead Mount
For .141" Cables, DC-18GHz VSWR1.2

PCN2EA50-0141A / 8XX

Mechanical Data

Environmental Data

Environmental Data	
Temperature Range	-55°C to +155°C
Thermal shock	MIL-STD-202, Meth. 107, Cond. B
Corrosion	MIL-STD-202, Meth. 101, Cond. B
Vibration	MIL-STD-202, Meth. 204, Cond. B
Shock	MIL-STD-202, Meth. 213, Cond. I
Moisture Resistance	MIL-STD-202, Meth. 106
RoHS	compliant

RPT 15

RG402, .141" Cables

Packing


Single or 100

N Jack (Female) Connector Cable Entry: Solder
 Contact Pin: Plug-in Attachment Bulkhead Mount
 For RG402, .141" Cables, DC-11GHz VSWR1.25




PCN2EA50-0141A / 8XX

Connector Type:	N2EA50-EZ141A/94	Inner Conductor Contact:	Plug-in
Suitable Cable:	RG402, .141" Semi-Rigid and Semi-Flex Cables RG402, .141" Flexible Cables	Outer Conductor Contact:	Soldered

Parts List of Connector:

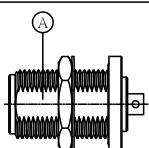

Assembly Steps:

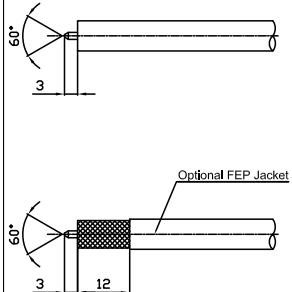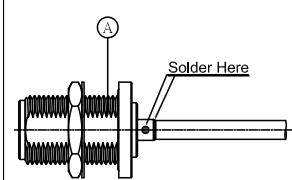Picture	Process	Attention/Check	Tools Required
For Semi-Rigid and Semi-Flex Cables: 	For Semi-Rigid and Semi-Flex cable: Trim cable according to drawing. Chamfer center contact. Dimension 15 mm applies to the FEP jacket cables.	Strip the cable end perpendicular to its axis. Do not damage center contact.	Blades Trim tools
For Flexible Cables: 	For Flexible Cable: Remove the cable jacket according to the picture and put the braid into liquid tin. Remove cable dielectric according to the drawing. Chamfer center contact.	Do not damage center contact, dielectric or braid. The liquid tin has to cover a length of 15 mm. If the cable does not fit into the cable entry, utilize a flat-nose plier to adjust the outer contact.	Blades Solder pot Flat-nose plier
	Slide connector body "A" over the cable. Solder connector body "A" to the cable (see drawing).	Avoid excessive heat. Immediately use alcohol to wipe the soldered area to reduce joint temperature and remove residuals.	Solder iron